



SERVICE BULLETIN

Classification:	Reference:	Date:
AN21-009A	NTB21-046A	June 18, 2021

SOFTWARE UPDATE FOR INFOTAINMENT ISSUES

This bulletin has been amended. See **AMENDMENT HISTORY** on the last page.
Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2020-2021 Titan/Titan XD (A61)

SERVICE INFORMATION

When diagnosing an infotainment issue, always confirm that the latest software is installed in the AV control unit before starting the diagnosis.

The software update in the following service procedure is to address the items below:

- Stability improvements and “bug” fixes.

Refer to steps 1 - 4 to confirm that this bulletin applies.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

REQUIRED SPECIAL TOOL

- One special tool, USB drive J-52727-1, has been shipped to each dealer (see Figure 1).
- Do not use any other USB drive to perform the procedure in this bulletin.
- Additional USB drives may be purchased from TechMate: nissantechmate.com or 1-800-662-2001.

HINT:

The update-software must be the only file on the drive.



Figure 1

BOSCH CONTACT INFORMATION

If additional assistance is required from Bosch, fill out the form below and email it to:
nissan.dealers@us.bosch.com

Bulletin Number	
Date	
Dealer Number	
Mailing Address:	Dealer Name
	Address and Street
	City
	State
	Zip Code
Order Placed By	(your name)
Current audio unit	Software version
Customer Concern	
Reason for request	<ul style="list-style-type: none">• Cannot download update software

SERVICE PROCEDURE

Check Version Information

1. Push the **MENU** button.



Figure 2

2. Select the **Info** Icon.
 - If the **Info** icon does not appear as shown in Figure 3, this bulletin does not apply.



Figure 3

3. Select **System Information** to access the vehicle update menu.



Figure 4

4. Select **Version Information**.

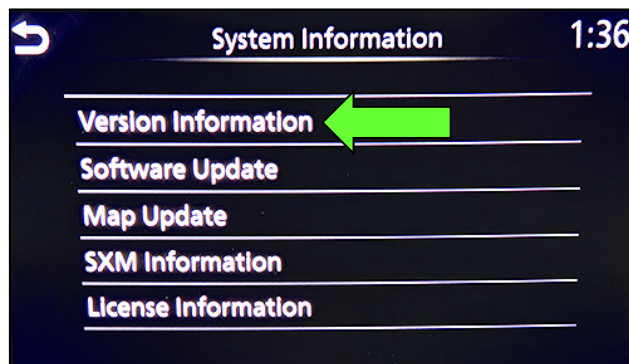


Figure 5

- If the Software Version is the version listed in **Table A**, select the back button and continue to step 5 on the next page.
- If the Software Version is NOT the version listed in **Table A**, select the back button, this bulletin **does not apply**.

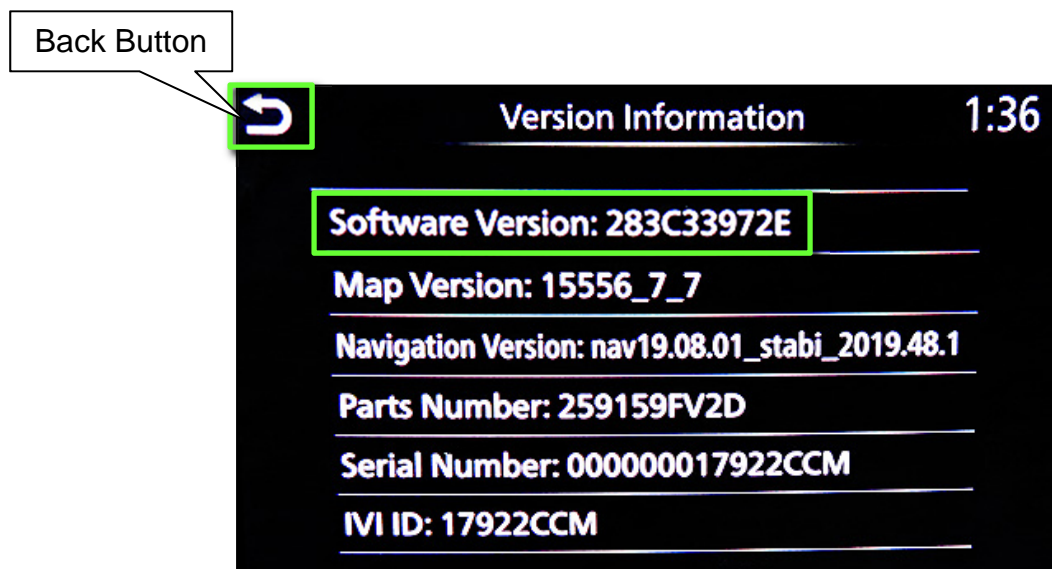


Figure 6

Table A

MODEL	SOFTWARE VERSION
Titan/Titan XD	283C33972E

Update the AV Control Unit

IMPORTANT: Before starting, make sure:

- ASIST is connected to the internet.
- ASIST has been synchronized (updated) to the current date.

5. Insert special tool USB drive J-52727-1 into an ASIST Station.

- If the infotainment software has already been downloaded onto special tool USB drive J-52727-1 from a prior service procedure, skip to step 14 on page 8.

HINT:

- Special tool USB drive J-52727-1 is the only USB drive approved for use with this procedure.
- The update-software is estimated to take **4 hours** to download to the USB drive.
- The update-software must be the only file on the USB drive.

6. Open ASIST.

7. Select **Specialty Tools**, and then select **Infotainment Software Updates**.

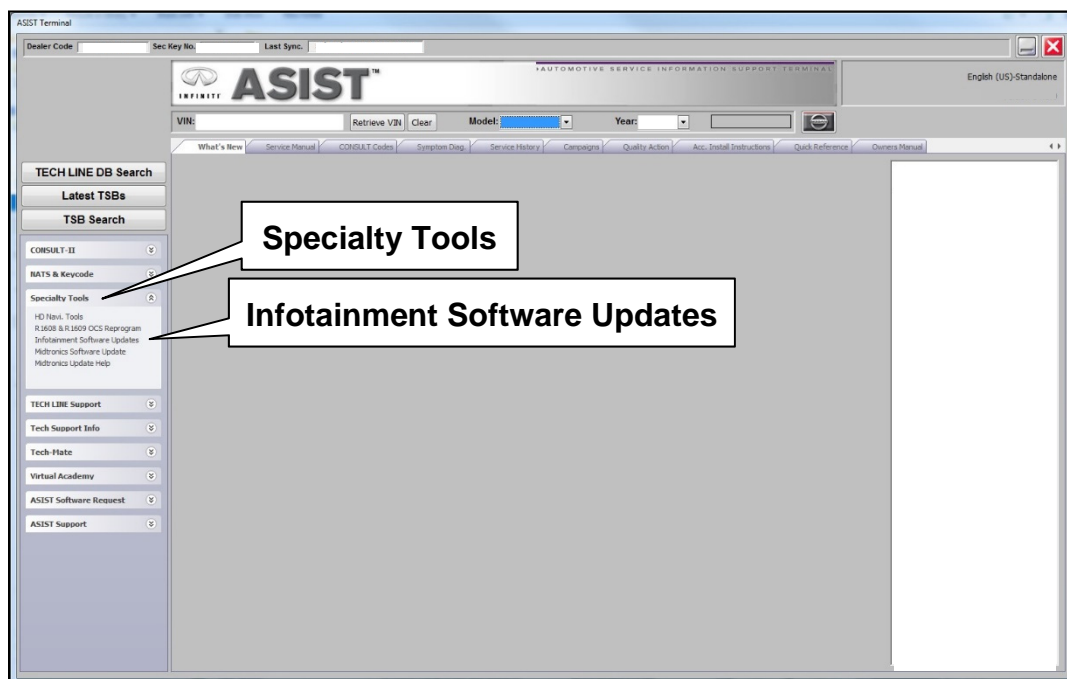


Figure 7

8. Select the check box next to infotainment update-software IVI301 (Figure 8).
9. Use the drop-down menu and select the location of the USB drive that was inserted in step 5.

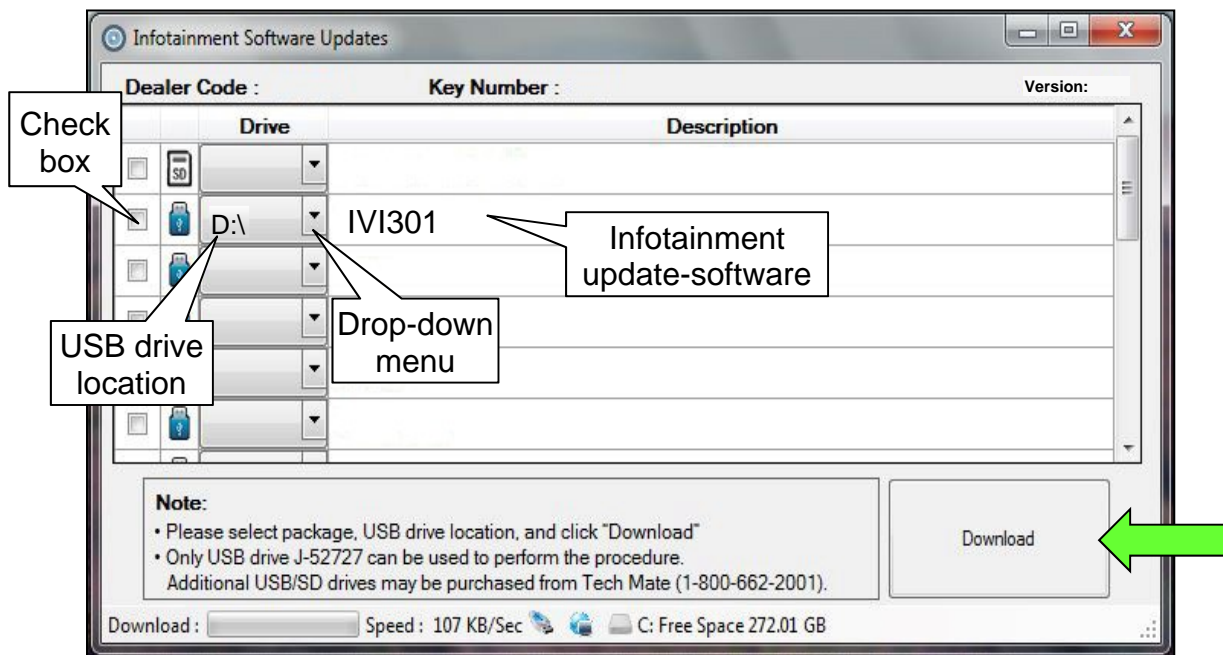


Figure 8

10. Select **Download**, and then wait for the download to complete.

HINT:

- The update-software is estimated to take 4 hours to download to the USB drive.
- If, while attempting to download the software to the ASIST Station, you receive the message shown in Figure 9:
 - a. First, attempt to clear space on the ASIST Station hard drive.
 - b. If space on the hard drive cannot be cleared, email Bosch at **nissan.dealers@us.bosch.com** for additional options.



Figure 9

11. Select **OK**.

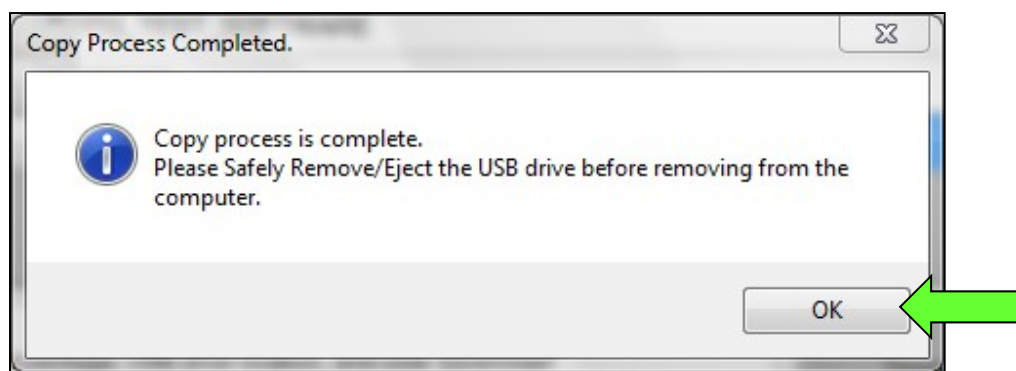


Figure 10

12. Once the transfer is complete, safely remove the USB drive from the ASIST Station.
 - a. From the PC toolbar, select the **Safely Remove Hardware** icon.
 - The icon is on the toolbar, or can be found after selecting the arrow.
 - b. Select the USB drive to be removed, and then remove the USB drive from the ASIST Station.

NOTICE Follow the steps to safely remove the USB drive. If not followed, the USB drive may corrupt the infotainment update-software.

- If you are not familiar with the process of safe USB drive removal, ask for assistance at your dealer.

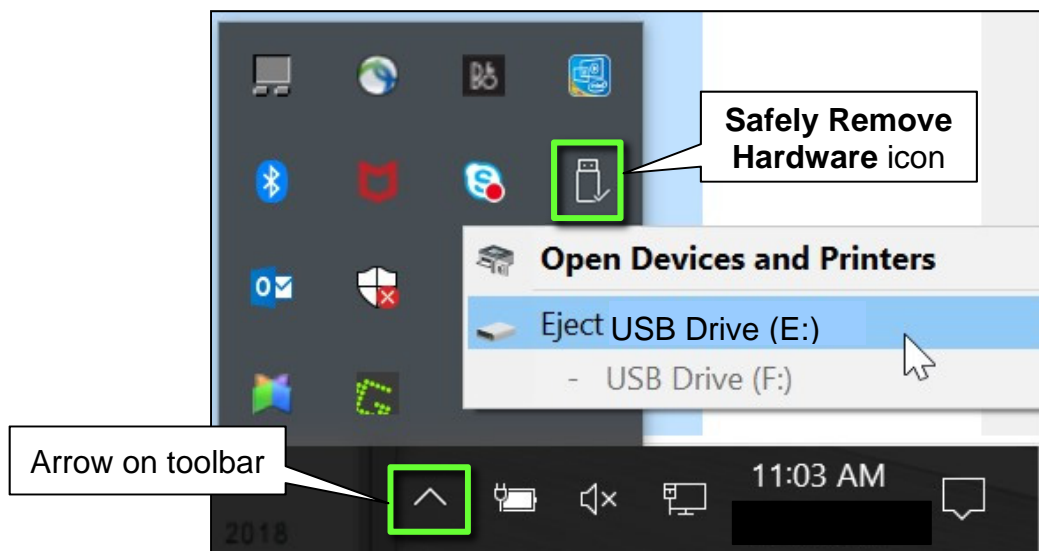


Figure 11

13. Close all ASIST **Infotainment Software Update** screens.
14. Set the parking brake.
15. Start the engine, and then wait 60 seconds for the system to load.

HINT: The engine needs to idle for the duration of the update to retain battery charge.

16. Insert the USB drive with the infotainment update-software into the vehicle's USB media port (see Figure 12).

- Do not remove the USB drive during the update to the vehicle until instructed to.

HINT: Charging ports are marked in the vehicle with a “lightning bolt” symbol.

NOTICE Do not insert the USB drive into a charging port. If used, the update-software and/or USB drive may become damaged. Only insert the USB drive in a USB media port.



Figure 12

17. Wait approximately 10-30 seconds for the screen in Figure 13 to appear.

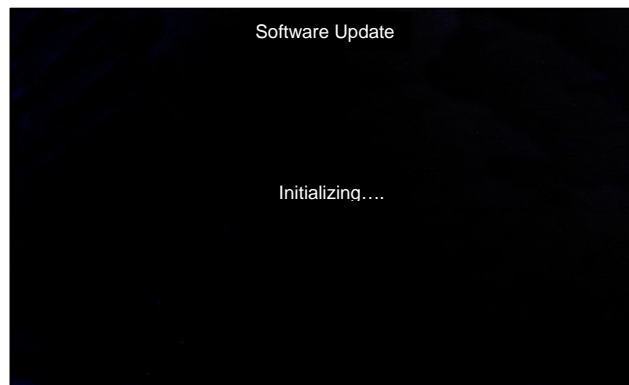


Figure 13

- The screen in Figure 14 may briefly appear. **Do not remove the USB drive.** The audio system will detect the USB and continue the update.



Figure 14

18. Wait for the update to complete.
- Follow the on-screen instructions while waiting.
- HINT:** The update may take 15-25 minutes.

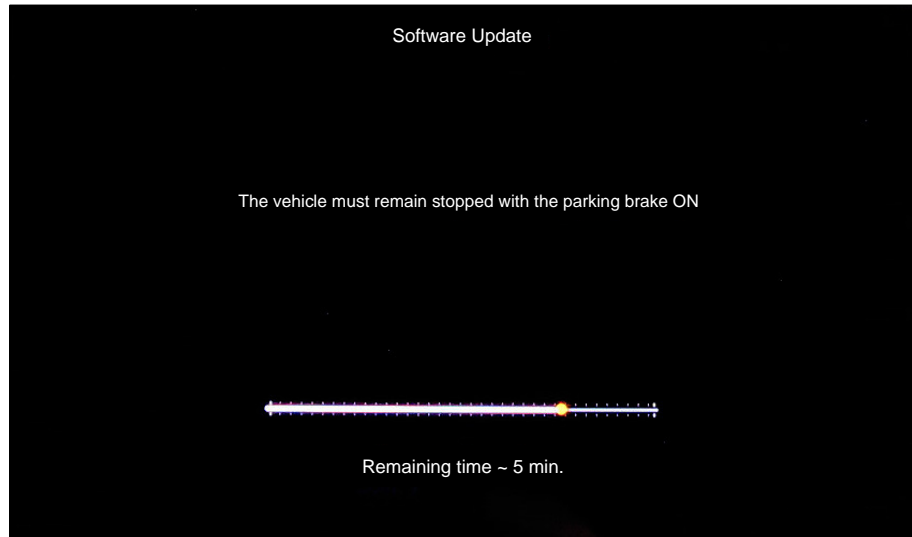


Figure 15

19. Once the update is complete (Figure 16), remove the USB drive; the system will reboot (restart).
- HINT:** The system will not reboot until the USB drive is removed.

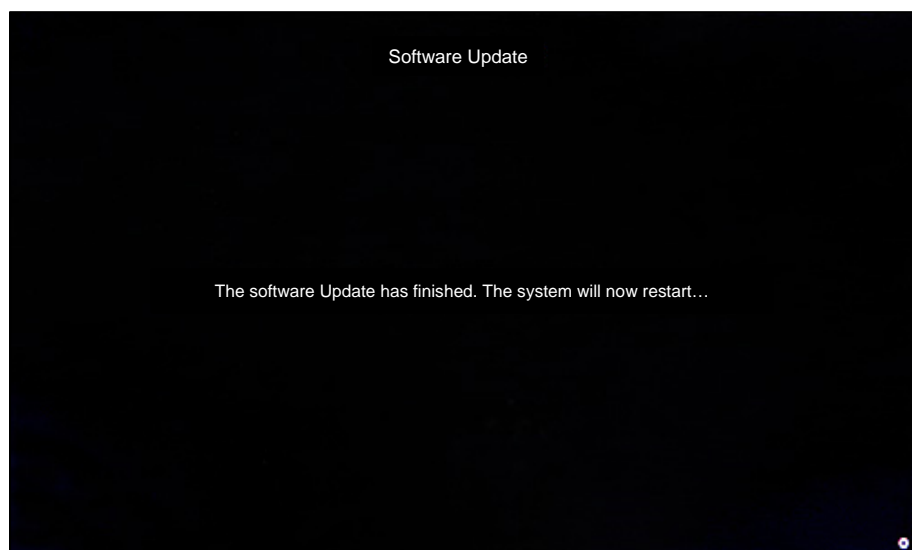


Figure 16

NOTICE Steps 20-27 must be completed. If they are not completed, the update may become corrupted.

20. Allow the reboot to complete (approximately 30 seconds).
 - The Nissan logo will be displayed during the reboot.



Figure 17

The steps below will fully reboot the infotainment system twice.

22. Open and close the driver door, and then ensure that all doors are closed.
23. Wait 5 minutes.

NOTICE Ensure that all doors remain closed during the five minute wait period. If a door is opened during the five minute wait period, the update may not complete and the AV control unit may become inoperable.

HINT: The engine does not need to be running for the next steps.

24. Turn the ignition ON (engine OFF) and wait for the Nissan logo to appear (Figure 17).
 - If the Nissan logo does not appear (this might take up to 30 seconds), start over from step 21.

25. After the Nissan logo appears, wait about 1 minute.
 - The MENU (Home) screen in Figure 18 will be displayed.



Figure 18

27. Repeat steps 22-26 one more time (for a total of 2 times to complete the update).

CLAIMS INFORMATION

Submit a Primary Operation (PO) type line claim using the following claims coding:

DESCRIPTION	OP CODE	SYM	DIA	FRT
Perform Software Check	RX8LAA	ZE	32	0.2

OR

Submit a Primary Operation (PO) type line claim using the following claims coding:

DESCRIPTION	OP CODE	SYM	DIA	FRT
Perform Software Check and Update	RX8MAA	ZE	32	0.3

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
May 27, 2021	NTB21-046	Original bulletin published
June 18, 2021	NTB21-046A	Claims Information updated

